

Manhole Inspection Summary

Manhole # S02KK1004MH

Printed On: 6/24/2010

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **02KK1** Node: **004** Status: **Found**

Insp Date: **1/29/08 9:41 AM**

Incomplete Comments

Crew: **RL, GH**
Inspector: **Lamont**
Firm: **URS**

Location Address: **5512 KENNISON AVE**

Cross Street: **LEMMEL AVE**

Manhole Type: **Junction**

Location: **Sidewalk**

Ground Conditions: **Standing Water**

☒ Prev. Rehab

Weather: **Light Rain**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **32** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☒ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

Chimney / Frame Adjustment

☐ Exists Material: **Brick**

☒ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☒ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Barrel

Material: **Brick**

☒ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☒ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☒ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **4** Missing: **0** ☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge

Depth:


(ft.)

☐ Active Surcharge Present

Location View



Top View

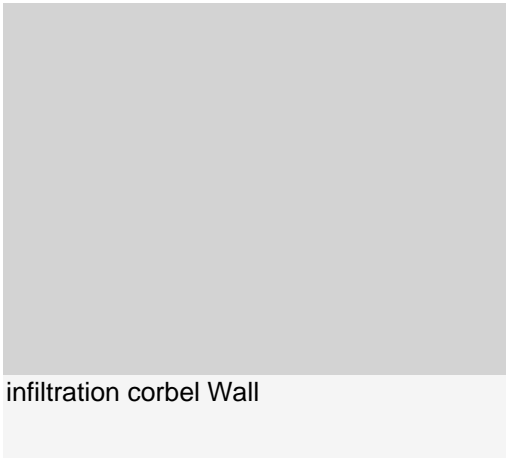

infiltration corbel Wall

Top View



CORBEL OFFSET

Manhole Inspection Summary

Manhole # S02KK1004MH

Printed On: 6/24/2010

Page 3 of 4

24 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **24** (in.) Rod and Bar (Angled)

Pipe Material: **DIP/CI** ☐ Pipe Lined

Invert Depth: **13.00** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**


Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

24 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: **24** (in.) Rod and Bar (Angled)

Pipe Material: **DIP/CI** ☐ Pipe Lined

Invert Depth: **12.80** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**


☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

Pipe In @ 9 O'Clock

9 O'Clock Inflow

Drop In @ 9 O'Clock

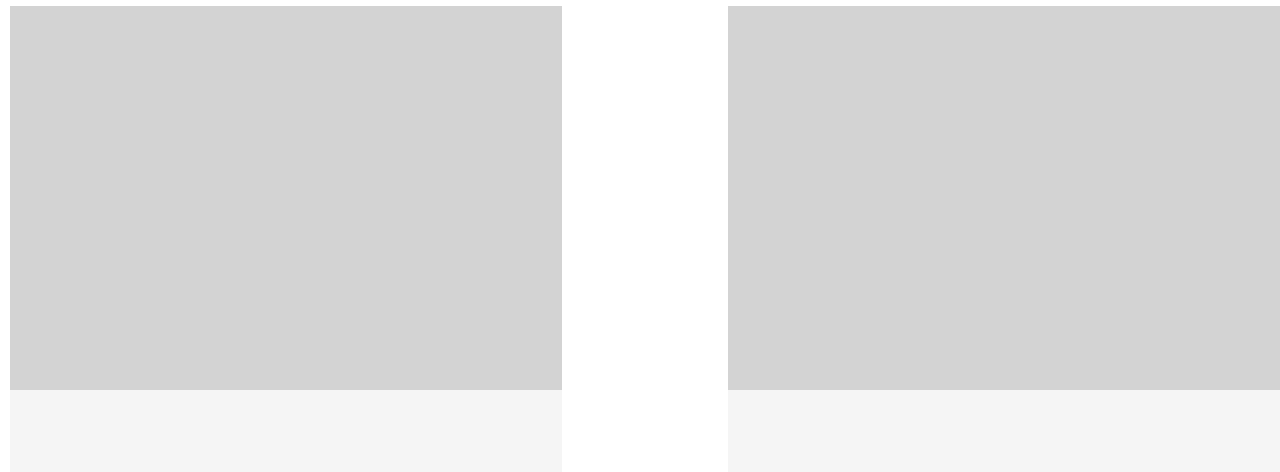

Pipe Height: 8.4 (in.) Rod and Bar (Angled)

Pipe Material: Clay

☐ Pipe Lined

Invert Depth: 10.00 (ft.) Flow Characteristics: Fast

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: None Pipe Seal Cond: Sound

Drop: Outside Rod and Bar

Angled: Yes Reading: 10.90 (ft.)

Inv Depth: 11.90 (ft.)

Drop Condition: Partly Clogged

Connects To: Manhole

☐ Possible Illicit Connection